INDEPENDENT

BATTERY CERTIFICATE

AVILOO
BATTERY DIAGNOSTICS

CERTIFICATE NUMBER: F3631CDA-5B36-4875-A6FA-CD86824A0387

VEHICLE

BRAND: Subaru
MODEL: Solterra - 71,4 kWh

MILEAGE: 28,285 mi
VIN: JTMABABA0PA037256
DATE AND TIME:
10/5/26, 12:24 PM

EXECUTED BY: 712 Auto Sales

RESULTS

Independent
STATE OF HEALTH (SOH)

97.4 %

ENERGY 62kWh | 64kWh

WLTP RANGE 281mi | 289mi

RATING

BENCHMARKING
How does your vehicle compare to comparable vehicles?

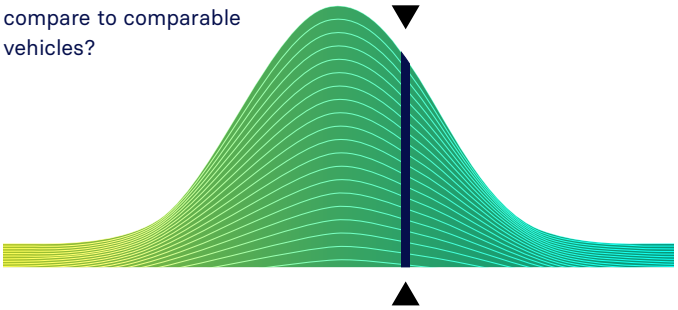

below average | average | above average

CHECKS

- Battery Management System (BMS) ✓
- Battery Sensor ✓
- Battery Measurements ✓
- Battery Cell Voltages ✓
- Vehicle Communication ✓

SCAN FOR DETAILS

EVALUATION

EXCELLENT HEALTH - NO ABNORMALITIES DETECTED

Based on the detailed battery diagnostics performed with the AVILOO FLASH Test, we hereby certify that the drive battery of this vehicle is in excellent condition.

The drive battery is therefore officially AVILOO Certified.

Dr. Marcus Berger, CEO

THIS BATTERY IS TESTED AND AVILOO CERTIFIED
AVILOO CERTIFIED

ENERGY

	Gross	Net (Nominal)	Usable
Current:	69.5kWh	62.3kWh	56.5kWh
New:	71.4kWh	64.0kWh	58.0kWh

SENSORS

Voltage Sensor	✓
Current Sensor	✓
Temperature Sensors	✓
Cell Voltage Sensors	✓

RANGE

	WLTP	Typical
Current:	281mi	195mi
New:	289mi	200mi

BMS

	Value	Status
BMS State of Charge (SoC)*:	45%	
SoC calculation accuracy:		✓
BMS State of Health (SoH)*:	100%	
SoH calculation accuracy:		✓

EXECUTION PROTOCOL

AVILOO Box connected.	12:24:06
FLASH Test started.	✓
Vehicle detected.	✓
Data acquisition started.	✓
Data acquisition completed.	✓
Data analysis started.	✓
Data analysis completed.	✓

MEASUREMENTS

	Min	Max	Delta	Status
Battery Temperature	65.9F	67.4F	1.5F	✓
Cell Voltage	3.672V	3.678V	6mV	✓
Pack Voltage	352.0V			
Average Current	-0.9A			

CELL VOLTAGES DIAGRAM

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
1 - 20	3.675	3.676	3.675	3.675	3.675	3.675	3.675	3.675	3.674	3.675	3.676	3.676	3.675	3.673	3.674	3.673	3.674	3.675	3.673	3.675
21 - 40	3.675	3.675	3.676	3.674	3.675	3.676	3.675	3.675	3.678	3.676	3.676	3.676	3.675	3.675	3.675	3.676	3.678	3.676	3.678	3.678
41 - 60	3.676	3.676	3.676	3.676	3.676	3.677	3.678	3.676	3.676	3.675	3.675	3.676	3.676	3.675	3.675	3.675	3.675	3.675	3.675	3.675
61 - 80	3.674	3.674	3.674	3.672	3.673	3.675	3.674	3.674	3.675	3.672	3.673	3.675	3.676	3.676	3.676	3.677	3.676	3.676	3.676	3.676
81 - 96	3.675	3.676	3.676	3.676	3.675	3.675	3.675	3.676	3.675	3.676	3.673	3.676	3.675	3.676	3.675	3.675				

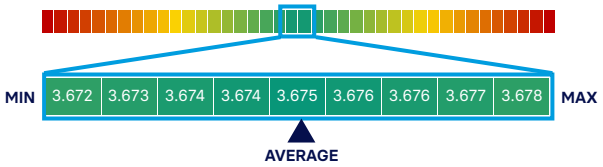

*The values shown here were read directly from the vehicle's battery management system (BMS) and are calculated and provided by the vehicle manufacturer. The State of Health (SoH) displayed corresponds to the value reported by the BMS and is CARA-certified.

DISCLAIMER: The test result includes the currently calculated state of health (SoH) of the drive battery. The determination is based on data provided by the vehicle. These are evaluated by AVILOO's algorithms using statistical and analytical models. Manipulation of the data in the control unit leads to an incorrect result. The indicated SoH has a technically induced fluctuation range (deviation) of no more than 3% in at least 95% of reference measurements. It should be noted that this tolerance applies to the SoH determination at the cell level and not to the SoH of the entire battery. This is because the state of charge of individual cells may vary, which can negatively affect the current SoH of the battery. However, this can be compensated by the Battery Management System (BMS) or during a calibration. The result reflects the condition of the battery at the time of the test. No conclusions can be drawn about the future state of health of the battery from this. Statements about mechanical damage or external influences are not part of this diagnosis.

AVILOO Inc. | 4949 S Syracuse St Ste 550 | 80237 Denver, CO | United States | help.usa@aviloo.com

F3631CDA-5B36-4875-A6FA-CD86824A0387